
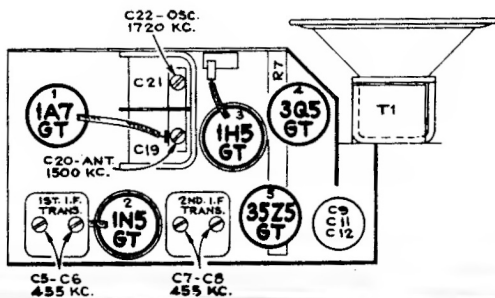


RCA 25 BP Portable

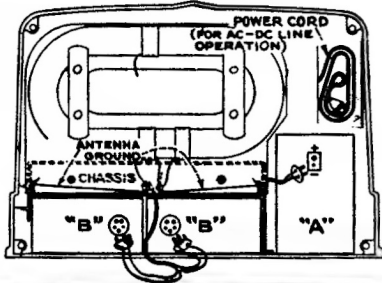

Steps	Connect the high side of test-oscillator to—	Tune test-osc. to—	Turn radio dial to—	Adjust the following for max. peak output—
1	I-F grid cap. in series with .01 mfd.	455 kc	Quiet point at 1,600 kc end of dial	C8, C7 (2nd I-F trans.)
2	1st-Det. grid cap. in series with .01 mfd.			C5, C6 (1st I-F trans.)
3	radiated signal 1,720 kc		Gang at min. capacity	C22 (Osc. Trimmer)
4	radiated signal 1,400 kc		signal frequency	C20 (Ant. Trimmer)